

Performance Silicone Air Intake Kit Part Number: 57-2199

Acura 2004-2008 TSX 2.4L

Installation Instructions

For technical inquiries please email us at tech@hpsperformance.com

In the email, please include the following information for faster response:

- Year / Make / Model / Engine of your vehicle.
- If it is a fitment issue, please include pictures showing the fitment problem.
- If there are missing parts, please list the part number(s) from the bill of materials on the 2nd page.
- Optional but recommended Your contact phone number and preferred call back time.

You can also give us a call via 626-747-9200 for tech support Monday-Friday, 9:00am-5:00pm Pacific Time.

Bill of Materials

Kit Number: 57-2199

Line #	Description	Part Number	Qty
1	Silicone Tube	HOSE-57-2199	1
2	Embossed Clamp, 12-22mm	EMSC-12-22	1
3	Embossed Clamp, 16-27mm	EMSC-16-27	1
4	Embossed Clamp, 70-90mm	EMSC-70-90	1
5	Embossed Clamp, 80-100mm	EMSC-80-100	1

- Before installing any parts of this intake kit, please read the instructions thoroughly.
- Verify the contents of this intake kit before disassembling your vehicle.
- DO NOT INSTALL IF ANY PARTS ARE MISSING OR DAMAGED. CONTACT <u>tech@hpsperformance.com</u> IMMEDIATELY. WE ARE NOT RESPONSIBLE FOR ANY DAMAGE CAUSED DUE TO IMPROPER INSTALLATION.
- Installation requires moderate mechanical skills. A qualified mechanic is highly recommended.
- Do not attempt to install the intake kit while the engine is hot.
- This installation may require removal of coolant lines that may be hot.
- For technical inquiries, please email us at tech@hpsperformance.com

PLEASE READ CAREFULLY BEFORE INSTALLATION!


This installation is not for the novice customer. Install this product with EXTREME caution! Misuse of this product can destroy your engine! If you are not mechanically inclined, please have a professional automotive mechanic install this kit.


NOTE: HPS holds no responsibility for any engine damage that results from misuse of this product.

GETTING STARTED


1. Turn the ignition OFF and disconnect the vehicle's negative battery cable. If the engine has run within the past two hours let it cool down.

NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner's manual. In the event your vehicle's anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicle's anti-theft code. We also highly recommend NOT discarding any stock parts after the installation.

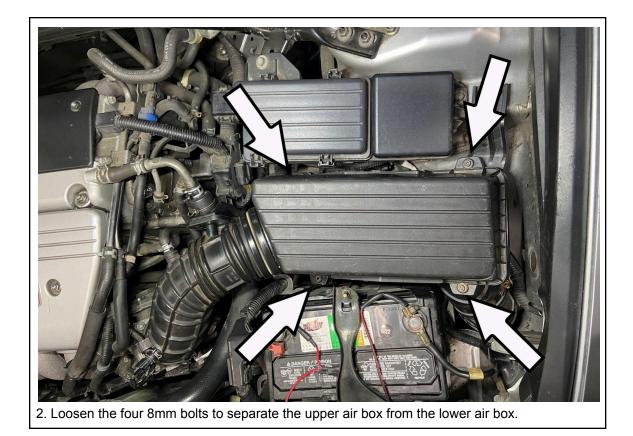


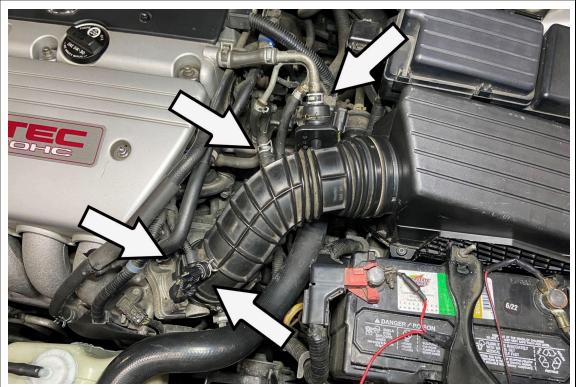


3. Disconnect the breather tube and the idle air hose from the intake tube. Next, remove the air temperature sensor from the intake tube and loosen the hose clamp securing the intake tube to the throttle body. Remove the intake tube along with the upper air box from the vehicle.

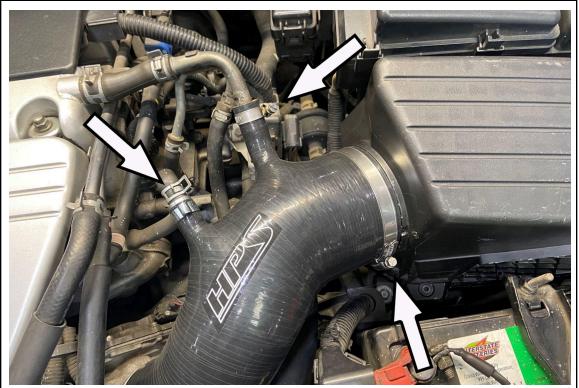

4. Connect the HPS intake tube to the upper air box using the provided EMSC-80-100 clamp and place the HPS intake tube and upper air box back into the vehicle. Push the breather tube into the HPS intake hose and secure it using the EMSC-16-27 clamp. Connect the idle air hose to the HPS intake barb and secure it with the factory clamp.

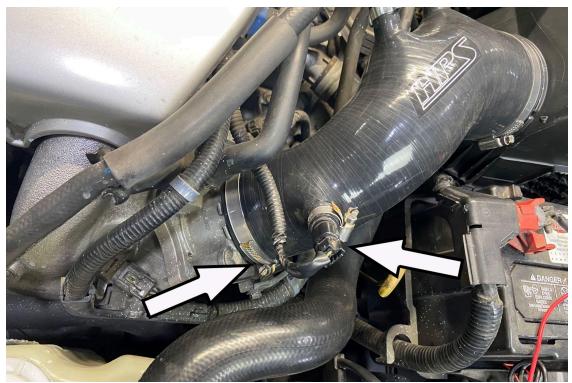

5. Connect the HPS intake tube to the throttle body and secure it with the provided EMSC-70-90 clamp. Push the air temperature sensor into the HPS intake tube and secure it using the provided EMSC-12-22 clamp.

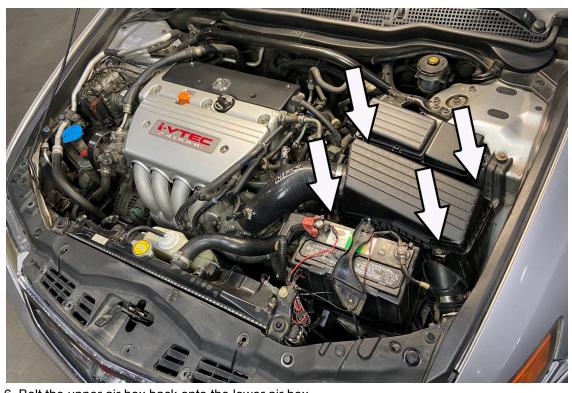

6. Bolt the upper air box back onto the lower air box.

FINAL STEPS

Once the intake has been positioned, tighten all of the clamps and secure all of the parts.


Upon completion of the installation, reconnect the negative battery terminal before you start the engine. Double check to make sure everything is tight and properly positioned before starting the vehicle.

Start the engine. Let the car idle for 3 minutes. Perform a final inspection before driving. Listen carefully for any odd noises, rattles and/or air leaks prior to taking it for a test drive. If any problems arise go back and check the vacuum lines, hoses and clamps that may be causing leaks or rattles and correct the problem.


Periodically, recheck the alignment of the intake kit and make sure there is proper clearance around and along the length of the intake. Failure to follow proper maintenance procedures may cause damage to the intake and will void the warranty.




HPS Performance Silicone Air Intake Kit 2004-2008 Acura TSX 2.4L 2003-2006 Honda Accord 2.4L (without MAF sensor) Part Number: 57-2199 Maximum Horsepower Gains = 6.4 whp @ 6200 rpm Tissed Veride 2007 Acura TSX 2.4L

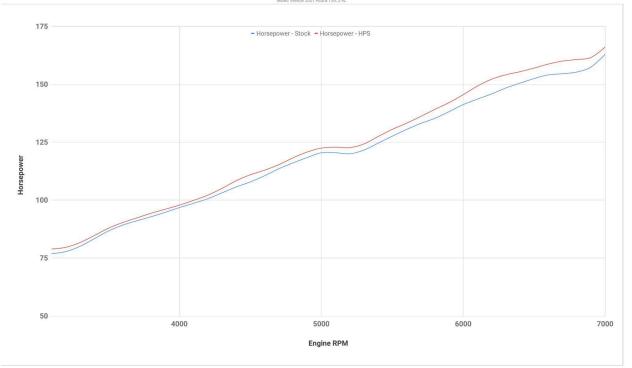

HPS Performance Silicone Air Intake Kit 2004-2008 Acura TSX 2.4L 2003-2006 Honda Accord 2.4L (without MAF sensor) Part Number: 57-2199 Maximum Torque Gains = 5.4 ft/lb @ 6200 rpm

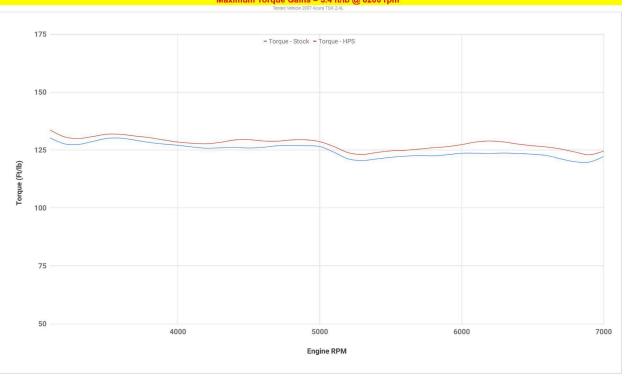

Also available for Acura 2004-2008 TSX 2.4L

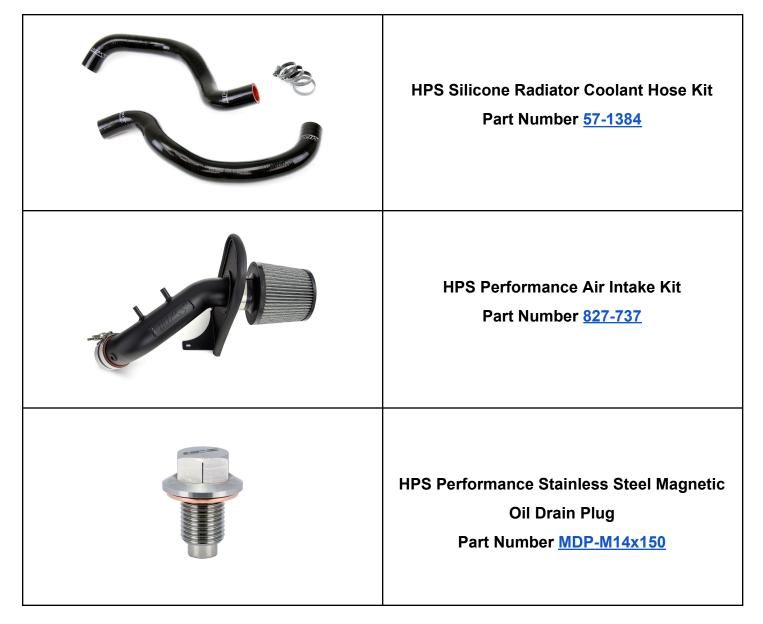

Contact an authorized HPS Performance dealer or visit us at <u>hpsperformance.com</u> for more details